


Deluxe Wall CO₂ Sensor, Protocol Communication

Individual or 3-in-1 with Modbus & BACnet Protocol Communication

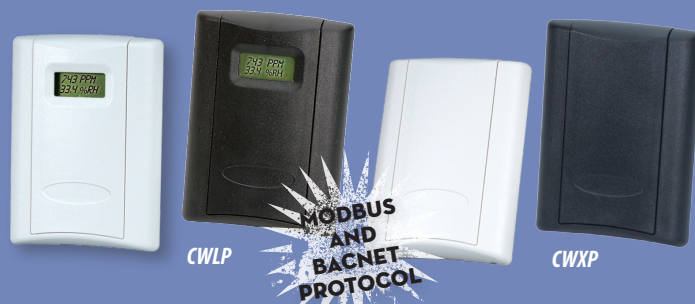

DESCRIPTION

CW Protocol Series is a non-dispersive infrared (NDIR) sensor designed for measuring CO₂ concentration in ventilation systems and indoor living spaces. Its measurement range of 0-5000 ppm makes it the premier solution for meeting ASHRAE and other ventilation efficiency standards.

CW Protocol devices feature embedded BACnet and Modbus communication protocols, as well as temperature and optional humidity sensors. An adjustable setpoint relay is provided for direct control and alarm applications, and the setpoint slider and pushbutton override offer additional local input.

APPLICATIONS

- Facilitating compliance with ASHRAE and other air quality standards
- Office buildings, schools, or other systems utilizing BACnet or Modbus protocol

FEATURES

- Embedded BACnet and Modbus communication protocols...easy systems integration
- Configurable to multiple baud rates...transfer data at the right speed for the system
- CO₂, humidity, and temperature sensors in one device at one address...provides more information and maximizes system capacity
- Local feature override capability from the building control system...added control and flexibility
- Innovative self-calibration algorithm...maximizes performance
- Field calibratable...minimize downtime
- Available with 2% NIST or 2% standard RH

SPECIFICATIONS



Input Voltage	12 to 30VDC, 24VAC; 100mA max.
Operating Temperature Range	No humidity option: 0° to 50°C (32° to 122°F); With humidity option: 10° to 35°C (50° to 95°F)
Operating Humidity Range	0-95% RH noncondensing
Housing Material	High impact ABS plastic, UL 94 V0
Protocol	BACnet or Modbus (selectable)
Connection	2-wire RS-485
Data Rate	9600, 19200, 38400, 57600 (Modbus), bps (selectable); 9600, 19200, 38400, 76800 (BACnet), bps (selectable)
Parity	None/Odd/Even (selectable-Modbus); None (BACnet)
Address Range	1-127

CO₂ Transmitter:

Sensor Type	Non-dispersive infrared (NDIR) diffusion sampling
Measurement Range	0-5000 ppm
Accuracy	± 30 ppm ± 2% of measured value*
Repeatability	± 20 ppm ± 1% of measured value

RH Transmitter Option:

HS Sensor	Replaceable digitally profiled thin-film capacitive; (32-bit mathematics); U.S. Patent 5,844,138
Accuracy**	±1% from 12 to 60% RH; ±2% from 10 to 80% RH; NIST traceable multi-point calibration
Reset Rate***	24 hours
Stability	±1% @ 20°C (68°F) annually for two years
Hysteresis	1.5% typical
Temperature Coefficient	±0.1% RH/°C above or below 25°C (typical)

Temperature Transmitter Option:

Sensor Type	Solid-state, integrated circuit
Accuracy	±0.5°C (±1°F) typical
Resolution	0.1°C (0.2°F)
Range	10° to 35°C (50° to 95°F)

Relay Contacts:

1 Form C (SPDT)	1A@30VDC, resistive; 30W max.
Setpoint Slider Resolution Option	1% full scale
Override Button Option	Remotely readable and resettable

EMC Conformance: Low voltage directive 2006/95/EC and EMC directive 2004/108/EC.

EMC Special Note: Connect this product to a DC distribution network or an AC/DC power adaptor with proper surge protection (EN 61000-6-1:2007 specification requirements)


* Measured at NTP

** Specified accuracy with 24VDC supplied power with rising humidity.


*** Reset rate is the time required to recover to 50% RH after exposure to 90% RH for 24 hours.

Note: Rough handling and transportation may cause a temporary reduction of CO₂ sensor accuracy. With time, the ABC function will tune the readings back to the correct accuracy range. The default tuning speed is limited to 30 ppm per week.

APPLICATION/WIRING DIAGRAM

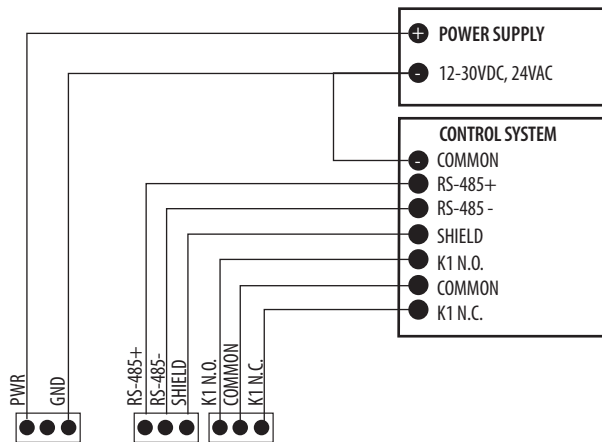

DIMENSIONAL DRAWING

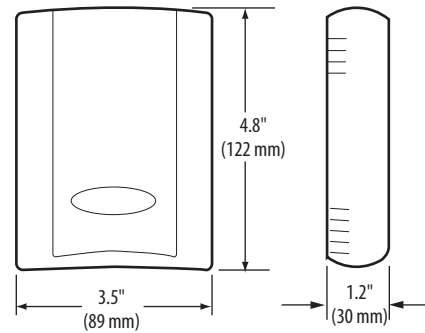ORDERING INFORMATION

Local Display	Protocol	RH Option	Temp. Option	Temp. Cal. Cert.	Option	Housing
CW ☐	☐ P	☐	☐	☐	☐	☐
L = LCD X = No Display	= Protocol	X = No RH 2 = RH 2% NIST H = RH 2%	X = No temp. T = Temp. transmitter	X = None 1 = 1 pt. cal. cert.* 2 = 2 pt. cal. cert.* 3 = 3 pt. cal. cert.*	Blank = None 1 = Pushbutton override 2 = Set point slider 3 = Pushbutton override + setpoint slider	Blank = Cloud white B = Black

Example:
 CW ☐ L ☐ P ☐ H ☐ T ☐ X ☐ 3 ☐

* Only available if temperature option is selected.

ACCESSORIES

Duct Aspiration Box and Outdoor Aspiration Box (AA35)
 Calibration kits and gases (AA01, AA26, AA27, AA28, AA29)
 Handheld air quality testers (1010, 1008, 770)
 Replacement covers and housing for wall units (AA51, AA51B, AA52, AA52B, AA55)

